High pressure check valves ST-264

1/4" F. Stainless steel.
↕ 62 mm. Opening pressure 0.05 - 0.1 bar.
Max. 400 bar / 90 °C

R+M Nr.	SW
200 264 500	19 mm

1/4" F. Brass.
↕ 62 mm. Opening pressure 0.05 - 0.1 bar.
Max. 150 bar / 90 °C

R+M Nr.	SW
200 264 510	19 mm

3/8" F. Stainless steel.
↕ 65 mm. Opening pressure 0.05 - 0.1 bar.
Max. 400 bar / 90 °C

R+M Nr.	SW
200 264 520	22 mm

3/8" F. Brass.
↕ 65 mm. Opening pressure 0.05 - 0.1 bar.
Max. 150 bar / 90 °C

R+M Nr.	SW
200 264 530	22 mm

1/2" F. Stainless steel.
↕ 90 mm. Opening pressure 0.05 - 0.1 bar.
Max. 400 bar / 90 °C

R+M Nr.	SW
200 264 540	27 mm

1/4" M. Stainless steel.
↕ 37.8 mm. Opening pressure 0.05 - 0.1 bar.
Max. 400 bar / 90 °C

R+M Nr.	SW
200 264 700	17 mm

Thermal relief valves

1/2" M : hose tail 8 mm. Valve with copper sonde. Working temperature 63 °C. Max. 10 bar

R+M Nr.
910 50

Assembly instructions of a relief valves

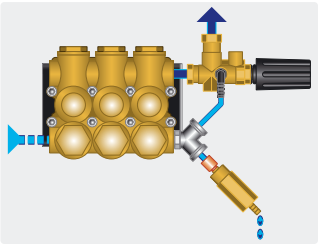

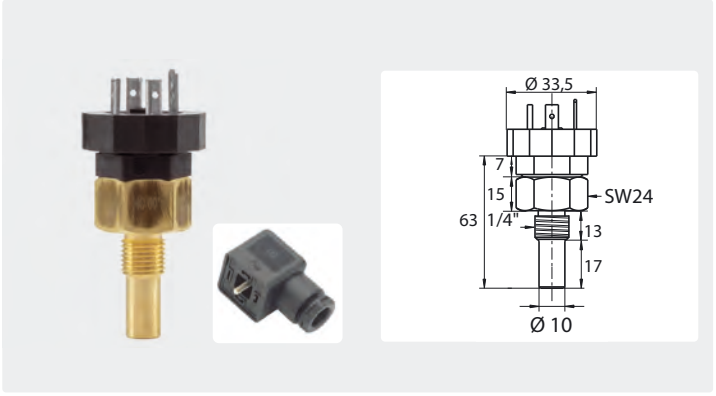

Bimetal temperature switch with plug. Switching point accuracy ± 5° C. Reset temperature 15…40K. Switching voltage up to AC 250 V / 2A. Max. 10 bar in the inlet. Switch 1/4" M

R+M Nr.	℃	○
910 513 560	60	1/4"
910 513 585	85	1/4"

1/2" M : hose tail 8 mm. Valve with copper sonde. Working temperature 63 °C. Max. 10 bar

R+M Nr.
910 55

3/8" M : hose tail 8 mm. Valve with copper sonde. Working temperature 63 °C. Max. 10 bar

R+M Nr.
910 65